



Mottagare: Kontrollanter, kontrollantelever, CI alla klubbar	Datum: 2019-10-09	BilagService Bulletin	Blad nr: 1 av 1
Fastställt av MK: 2019-10-09		Ärende: Materielvarning nr. 2019/1	
Ersätter:		Utfärdare: SFF Materielkommitté (MK)	

Bakgrund

Tillverkaren meddelar att det kan förekomma bärremmar med felaktiga 3-ringar.

Omfattning

All bärremmar tillverkade av SIFE.

Åtgärd

Kontrollera 3-ringarna enligt Service Bulletinen. Vid ev. fel eller vid osäkerhet skall tillverkaren eller hans svenska representant kontaktas.

När

Före nästa hopp.

Vem

Kontrollant 2 eller 3

Bilaga

Service Bulletin 2017-002



Diana Duschek
Hauptstrasse 126
A-8740 Zeltweg

UID: ATU68019459
+43 699 18100656
www.sife.at

Service Bulletin 2017-002

Issue Date: October 2, 2017

Issue Number: 2017-002

Subject: Ring position on SIFE main risers

Status: mandatory before the next jump

Background:

We have been informed that during the simulation of a cutaway procedure, the 3-ring-system released only after a short tug on the risers. The result of our investigations is that the position of the small ring on the affected main risers may not meet the design specifications.




Diana Duschek
Hauptstrasse 126
A-8740 Zeltweg

UID: ATU68019459
+43 699 18100656
www.sife.at

Procedures to be followed:

1. Check the ring position on your main risers with the following figure:

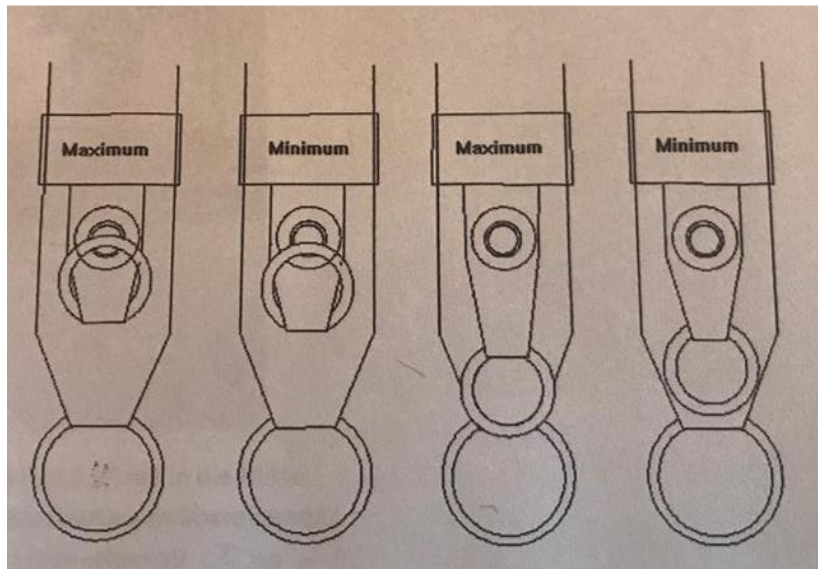

2. If your main risers do not meet the design specifications, or if you are unsure please send us an e-mail to office@sife.at.

The main riser replacement will be free of charge.

We apologize to all customers who are affected by this service bulletin.

Please contact SIFE for any further information:

SIFE
Hauptstrasse 126
8740 Zeltweg
office@sife.at
0043 699 181 00 656

Authorised Signatory

Diana Duschek
Head of Design
office@sife.at
+43 699 181 00 656

Distribution

Austro Control
Aeroclub
SIFE Dealers
Direct Customers