



Mottagare: Kontrollanter, kontrollantelever, CI alla klubbar		Datum: 2019-10-14	Bilag: Service Bulletin	Blad nr: 1 av 1
		Ärende: Materielmeddelande nr. 2019/4		
Fastställt av MK: 2019-10-14	Ersätter:	Utfärdare: SFF Materielkommitté (MK)		

Bakgrund

För att förhindra en ev. fördröjning av reservutlösningen, erbjuder tillverkaren ett utbyte av reservflikens lock på berörda system.

Omfattning

SIFE system tillverkade t.o.m Mars 2018 med containerstorlek:

00:00 • 01:00 • 02:00 • 03:00

Åtgärd

Kontakta tillverkaren eller hans svenska representant för åtgärd.

Bilaga

SIFE: Service Bulletin 2018-001



Diana Duschek
Hauptstrasse 126
A-8740 Zeltweg

UID: ATU68019459
+43 699 18100656
www.sife.at

Service Bulletin 2018-001

Issue Date: March 30, 2018

Issue Number: 2018-001

Subject: Upgrade reserve cover flap

SIFE is offering an upgrade on the reserve cover flap.


Status: advisory

Identification:

Name: SIFE harness & container systems in the following container sizes:

- 00:00
- 01:00
- 02:00
- 03:00

All SIFE harness & container systems after **DOM 03/18** or with the SIFE stamp on the inside of the reserve cover flap are not subject to this service bulletin.

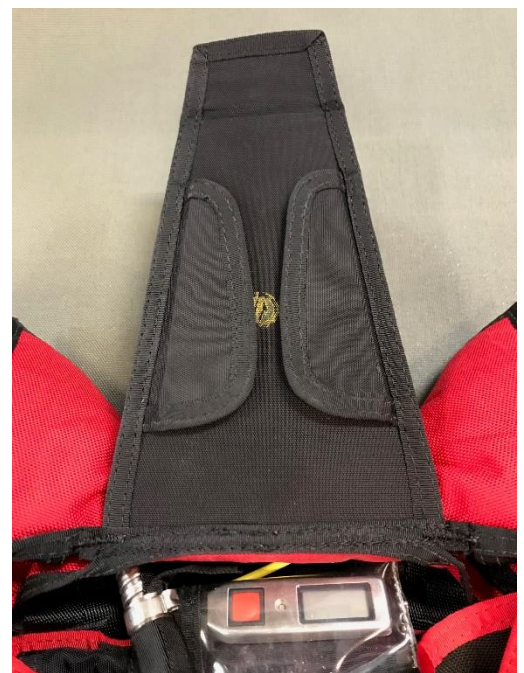



Diana Duschek
Hauptstrasse 126
A-8740 Zeltweg

UID: ATU68019459
+43 699 18100656
www.sife.at

Background:

We have been informed that during the annual reserve repack the reserve container opened with a delay of 0,18 seconds after pulling the reserve ripcord handle. The reserve cover flap wasn't moved or opened before the reserve ripcord handle was pulled.

The result of our investigations is that an increased friction between the reserve cover flap and the reserve container can lead to the unlikely event of a short delay of the opening of the reserve container.

Procedures to be followed:

1. Make sure that the reserve cover flap and the reserve container is clean before jumping.
2. Open the reserve cover flap to check your pin, the reserve loop and your Cypres before jumping.

We are offering an upgraded reserve cover flap free of charge to all our customers who own an affected container size.

Please contact SIFE for any further information:

SIFE
Hauptstrasse 126
8740 Zeltweg
office@sife.at
0043 699 181 00 656

Authorised Signatory

Diana Duschek
Head of Design
office@sife.at
+43 699 181 00 656

Distribution

Austro Control
Aeroclub
SIFE Dealers
Direct Customers